



# Tech Info Library

## Monitor II: Sparking or Arcing Inside the Monitor

This article last reviewed: 10 February 1988

PROBLEM DESCRIPTION: Crackling noise coming from inside the monitor's case.

WARNING: If your Monitor II exhibits the problem described above, perform the following two steps before continuing with this procedure.

1. Turn off the Monitor II and unplug it.
2. Discharge the CRT as described in the Tech Procedures binder.

CAUSE: 1. The anode connector may not be seated.  
2. The CRT's tip may be broken or cracked.

CURE: 1. Check the anode connector to see that it is properly seated (refer to the Tech Procedures for the anode connector's location).  
2. If the CRT's anode connector is broken or cracked, replace the CRT as described in the Tech Procedures binders.

If the above cure doesn't solve your problem refer to the Tech Procedures to obtain the general troubleshooting procedure for this product.

Copyright 1988 Apple Computer, Inc.

Keywords: hts

=====

This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 1688