



Tech Info Library

Macintosh 5200 & 5300 Computers: Rattling Noise (12/95)

Article Created: 14 December 1995

TOPIC -----

Recently my Macintosh Performa 5200 has started making a continuous rattling sound at startup. What could be causing this?

DISCUSSION -----

You likely have the Apple External Video Connector (M4099LL/A) installed in your computer. The ribbon cable of this connector can sometimes rise up and contact the exposed blades of the fan assembly, which causes this noise.

To resolve this issue, press the ribbon cable down flat, or (if the cable is long enough), fold it as recommended in the External Video Connector User's Guide.

Note that this symptom can occur in any of the following computers:

- Power Macintosh 5200/75 LC
- Power Macintosh 5300/100 LC
- Macintosh Performa 5200 series
- Macintosh Performa 5300 series

Support Information Services
Copyright 1995, Apple Computer, Inc.

Keywords: kppc,hts

=====

This information is from the Apple Technical Information Library.

19960215 11:05:19.00

Tech Info Library Article Number: 19061