



Tech Info Library

Power Macintosh 7200 & 7500: Difficulty Mounting CDs (12/95)

Article Created: 07 December 1995

TOPIC -----

I have a Power Macintosh 7200 series computer. When I hold down the C key and try to start up the computer using the system software CD-ROM disc, I get a flashing question mark. I am also having difficulty mounting other CD-ROM disks.

DISCUSSION -----

The Power Macintosh 7200 and 7500 series computers have a "kickstand" or bracket which prevents the internal component cage from opening. However, if this bracket is not secure, it can cause enough tension on the internal SCSI ribbon cable to pull it from the SCSI connector. This is the likely cause of the difficulties you are experiencing with CD-ROM discs.

To resolve this, snap the bracket securely into place and then reconnect the internal SCSI ribbon cable.

Support Information Services

Copyright 1995, Apple Computer, Inc.

Keywords: hts,ksts,kppc

=====

This information is from the Apple Technical Information Library.

19960924 07:31:19.00

Tech Info Library Article Number: 19029